


FED. ROAD REC. NO.	STATE	FEDERAL AID PROJECT NO.	SHEET NO.	TOTAL SHEETS
1	N.Y.		65	82
VERTICAL REHABILITATION PROGRAM CONTRACT C				
5 BRIDGES - BRONX COUNTY				
P.I.N. X803.90.101				

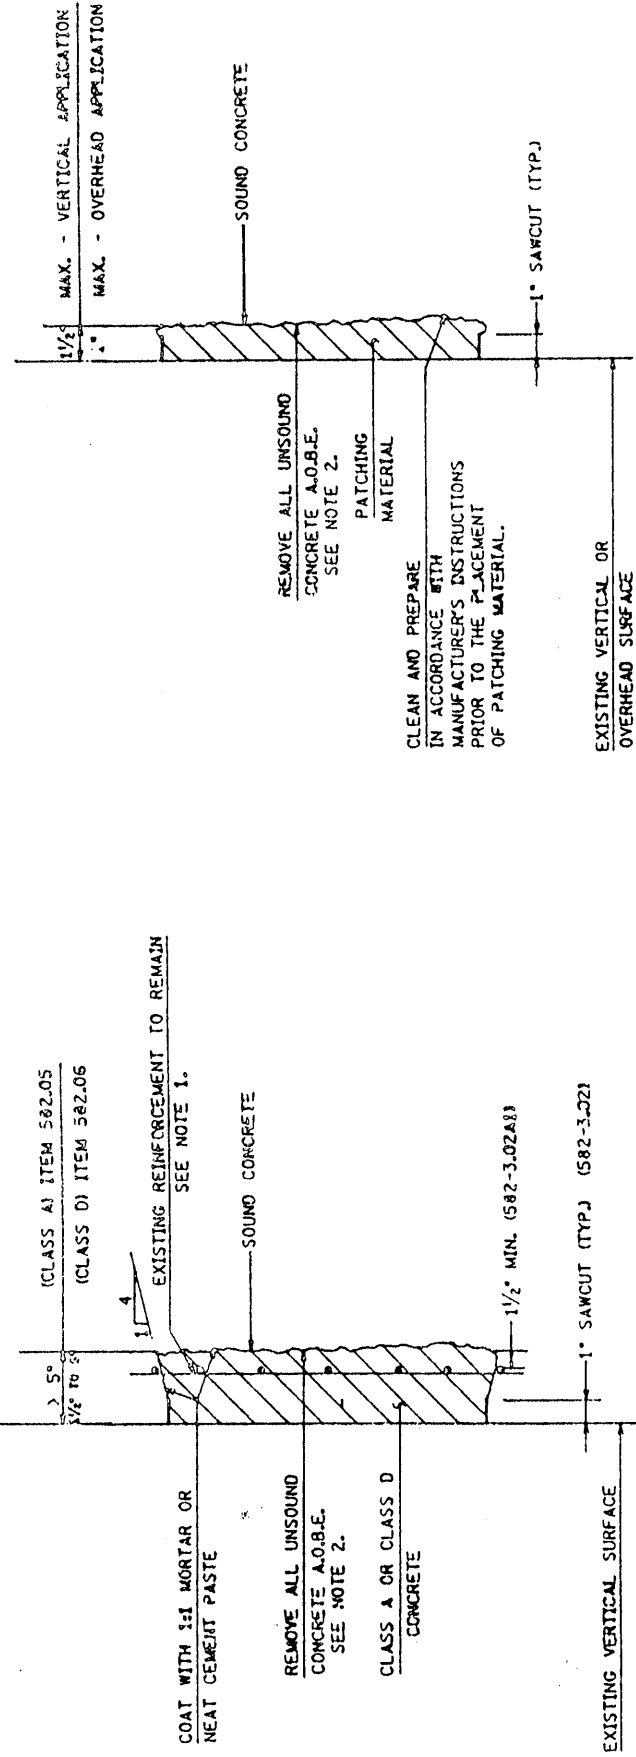

TYPE I REPAIR

ITEM 582.05 AND 582.06

N.T.S.


TYPE II REPAIR

ITEM 582.07

N.T.S.

NOTES:

1. EXISTING REINFORCEMENT EXPOSED BEFORE AND DURING THE REMOVAL OF UNSOUND CONCRETE SHALL REMAIN UN Damaged. ALL EXPOSED REINFORCEMENT RECEIVING NEW MATERIAL SHALL BE BE CLEANED IN ACCORDANCE WITH SECTION 556-3.01A OF THE STANDARD SPECIFICATIONS. IF EXPOSED REINFORCEMENT IS CORRODED IT SHALL BE STRENGTHEND TO ATTAIN ORIGINAL STRENGTH A.O.B.E.
2. ALL UNSOUND CONCRETE SHALL BE REMOVED AS REQUIRED BY THE ENGINEER TO ALLOW SATISFACTORY SURFACE REHABILITATION AND SHALL BE RESTORED TO MATCH EXISTING SURFACE.
3. THE ACTUAL TYPE OF REPAIR TO BE USED SHALL BE VERIFIED BY THE ENGINEER AFTER THE CONTRACTOR HAS PROPERLY PREPARED THE SURFACE IN ACCORDANCE WITH THE DETAILS SHOWN ON THE PLANS AND THE SPECIFICATIONS.

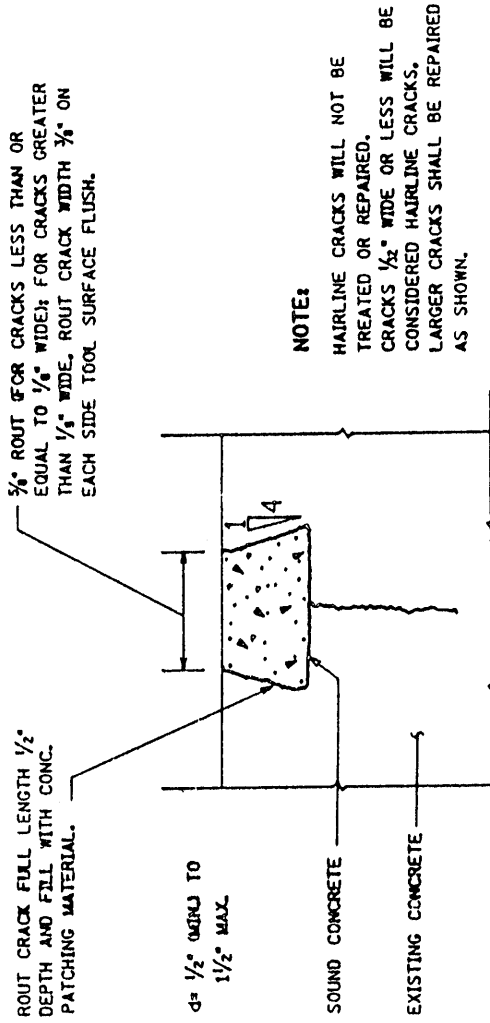

NOTE:
HAIRLINE CRACKS WILL NOT BE TREATED OR REPAIRED.
CRACKS 1/2" WIDE OR LESS WILL BE CONSIDERED HAIRLINE CRACKS.
LARGER CRACKS SHALL BE REPAIRED AS SHOWN.

CRACK REPAIR DETAIL

ITEM 582.07
N.T.S.

AS-BUILT REVISIONS

SIGNATURE

DATE

CONCRETE REPAIR DETAILS

STATE OF NEW YORK
DEPARTMENT OF TRANSPORTATION